



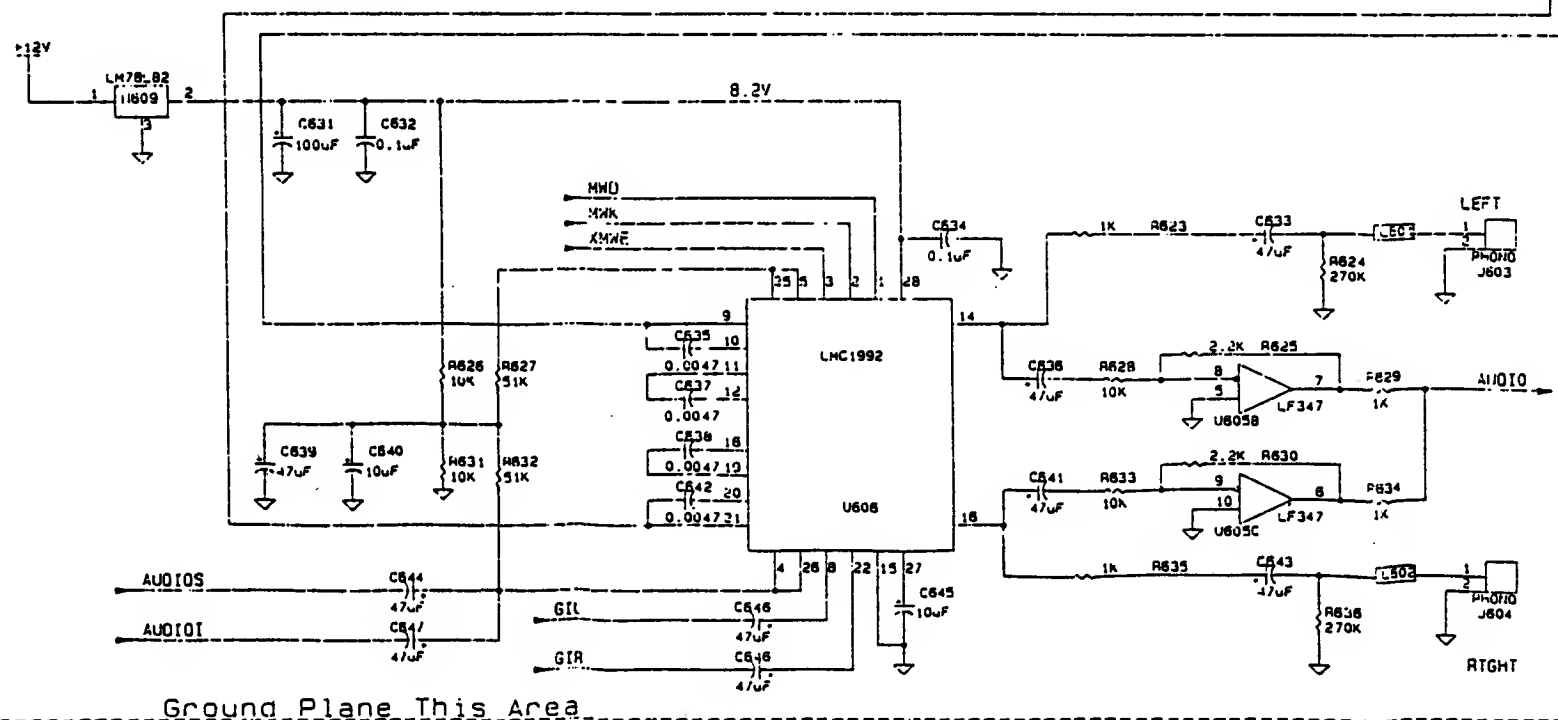
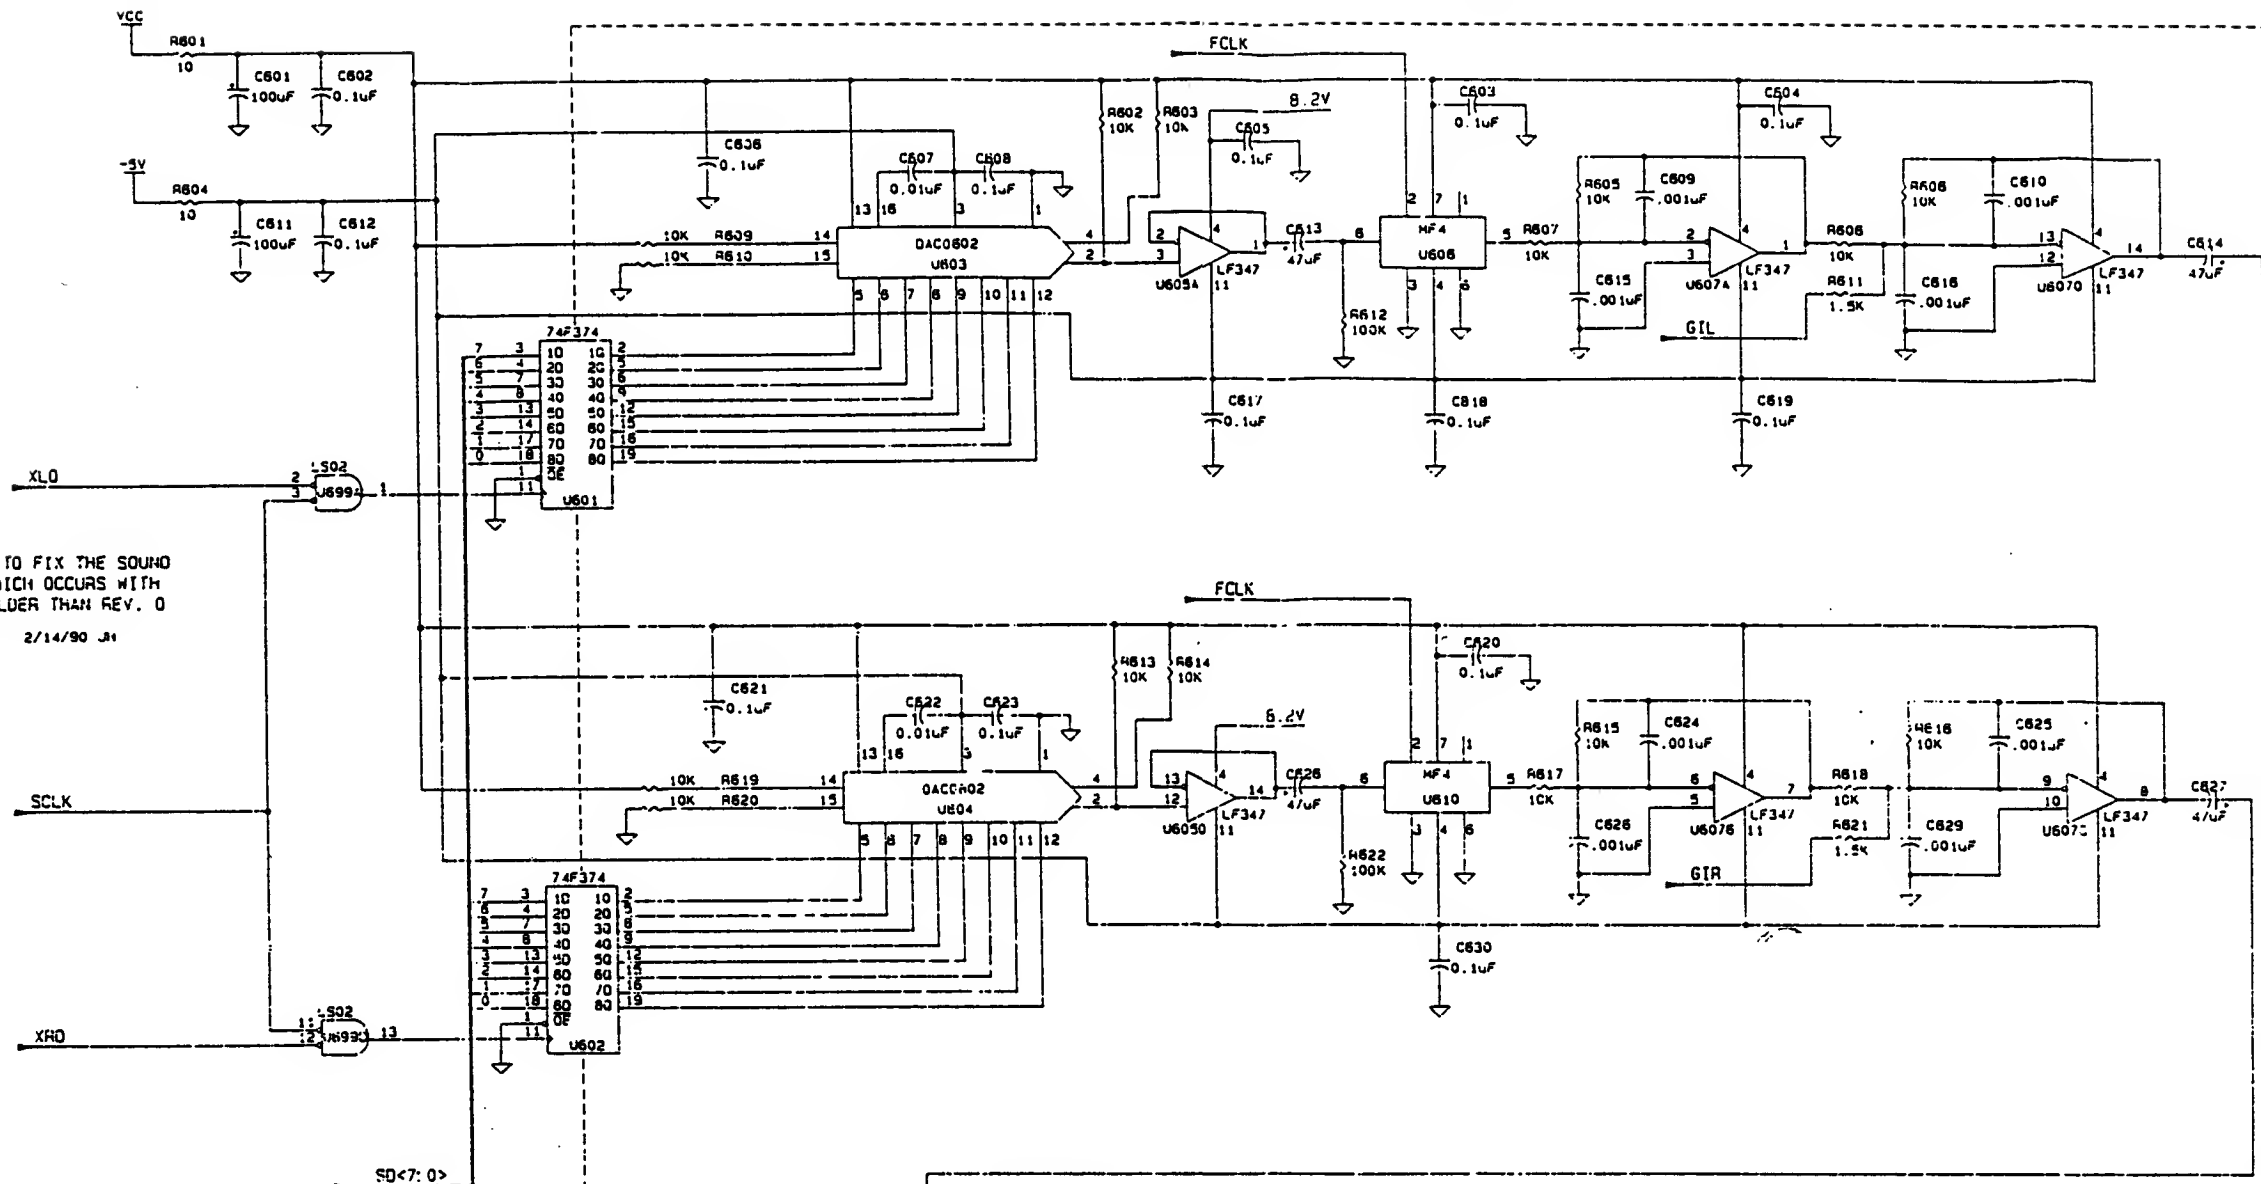



THE 74LS02 HAS ADDED TO FIX THE SOUND
DATA HOLD PROBLEM WHICH OCCURS WITH
ST-4117 (SHIFTERS) OLDER THAN REV. 0
2/14/90 JH

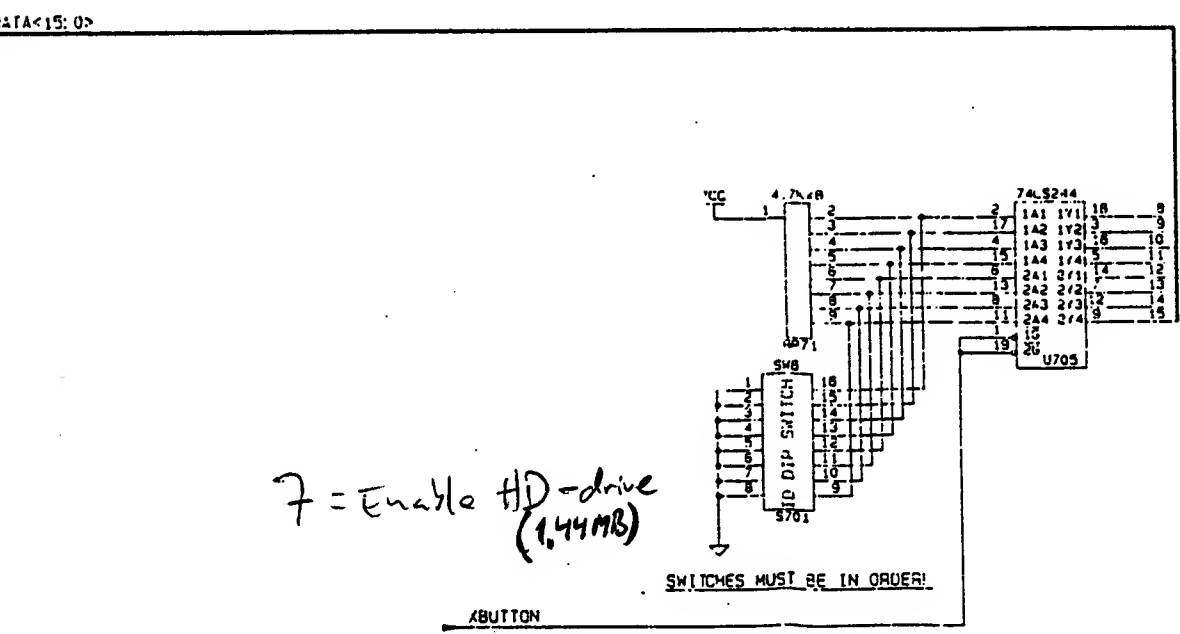


Atari Corporation			
1196 Borregas Ave. Sunnyvale, CA 94086			
MEGA STE			
SIZE	CODE	C00000-000	REV
0		ENGINEER: JOHN HORTON	2
DATE: APRIL 20, 1990 SHEET 8 OF 11			


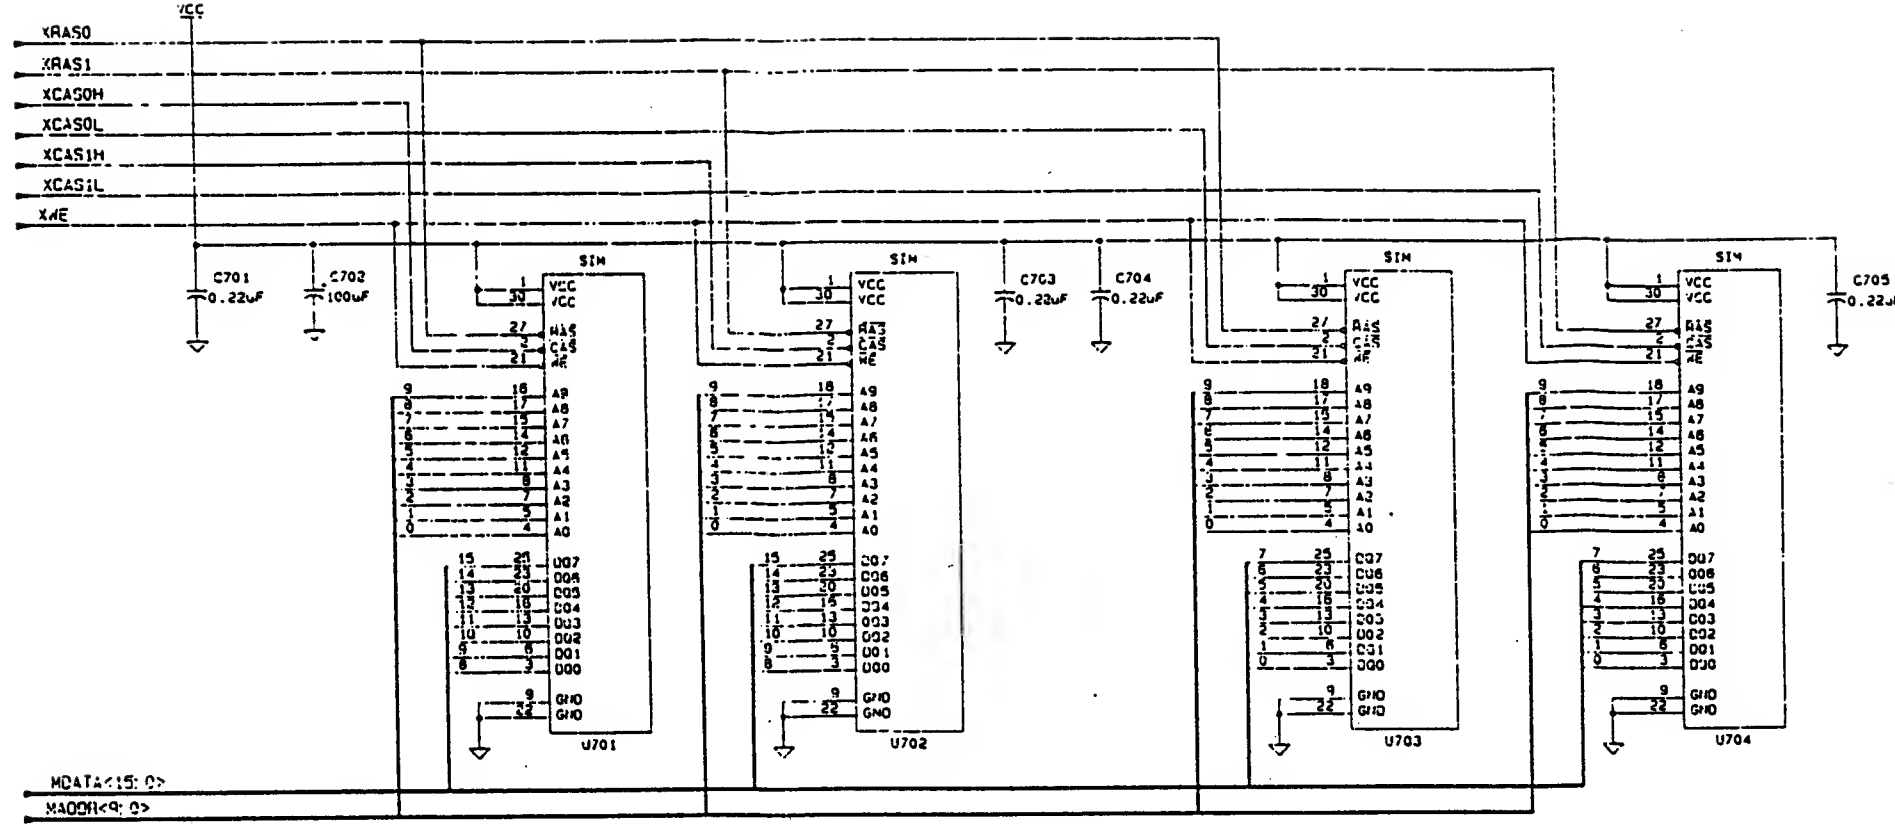


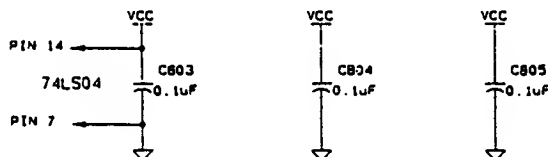

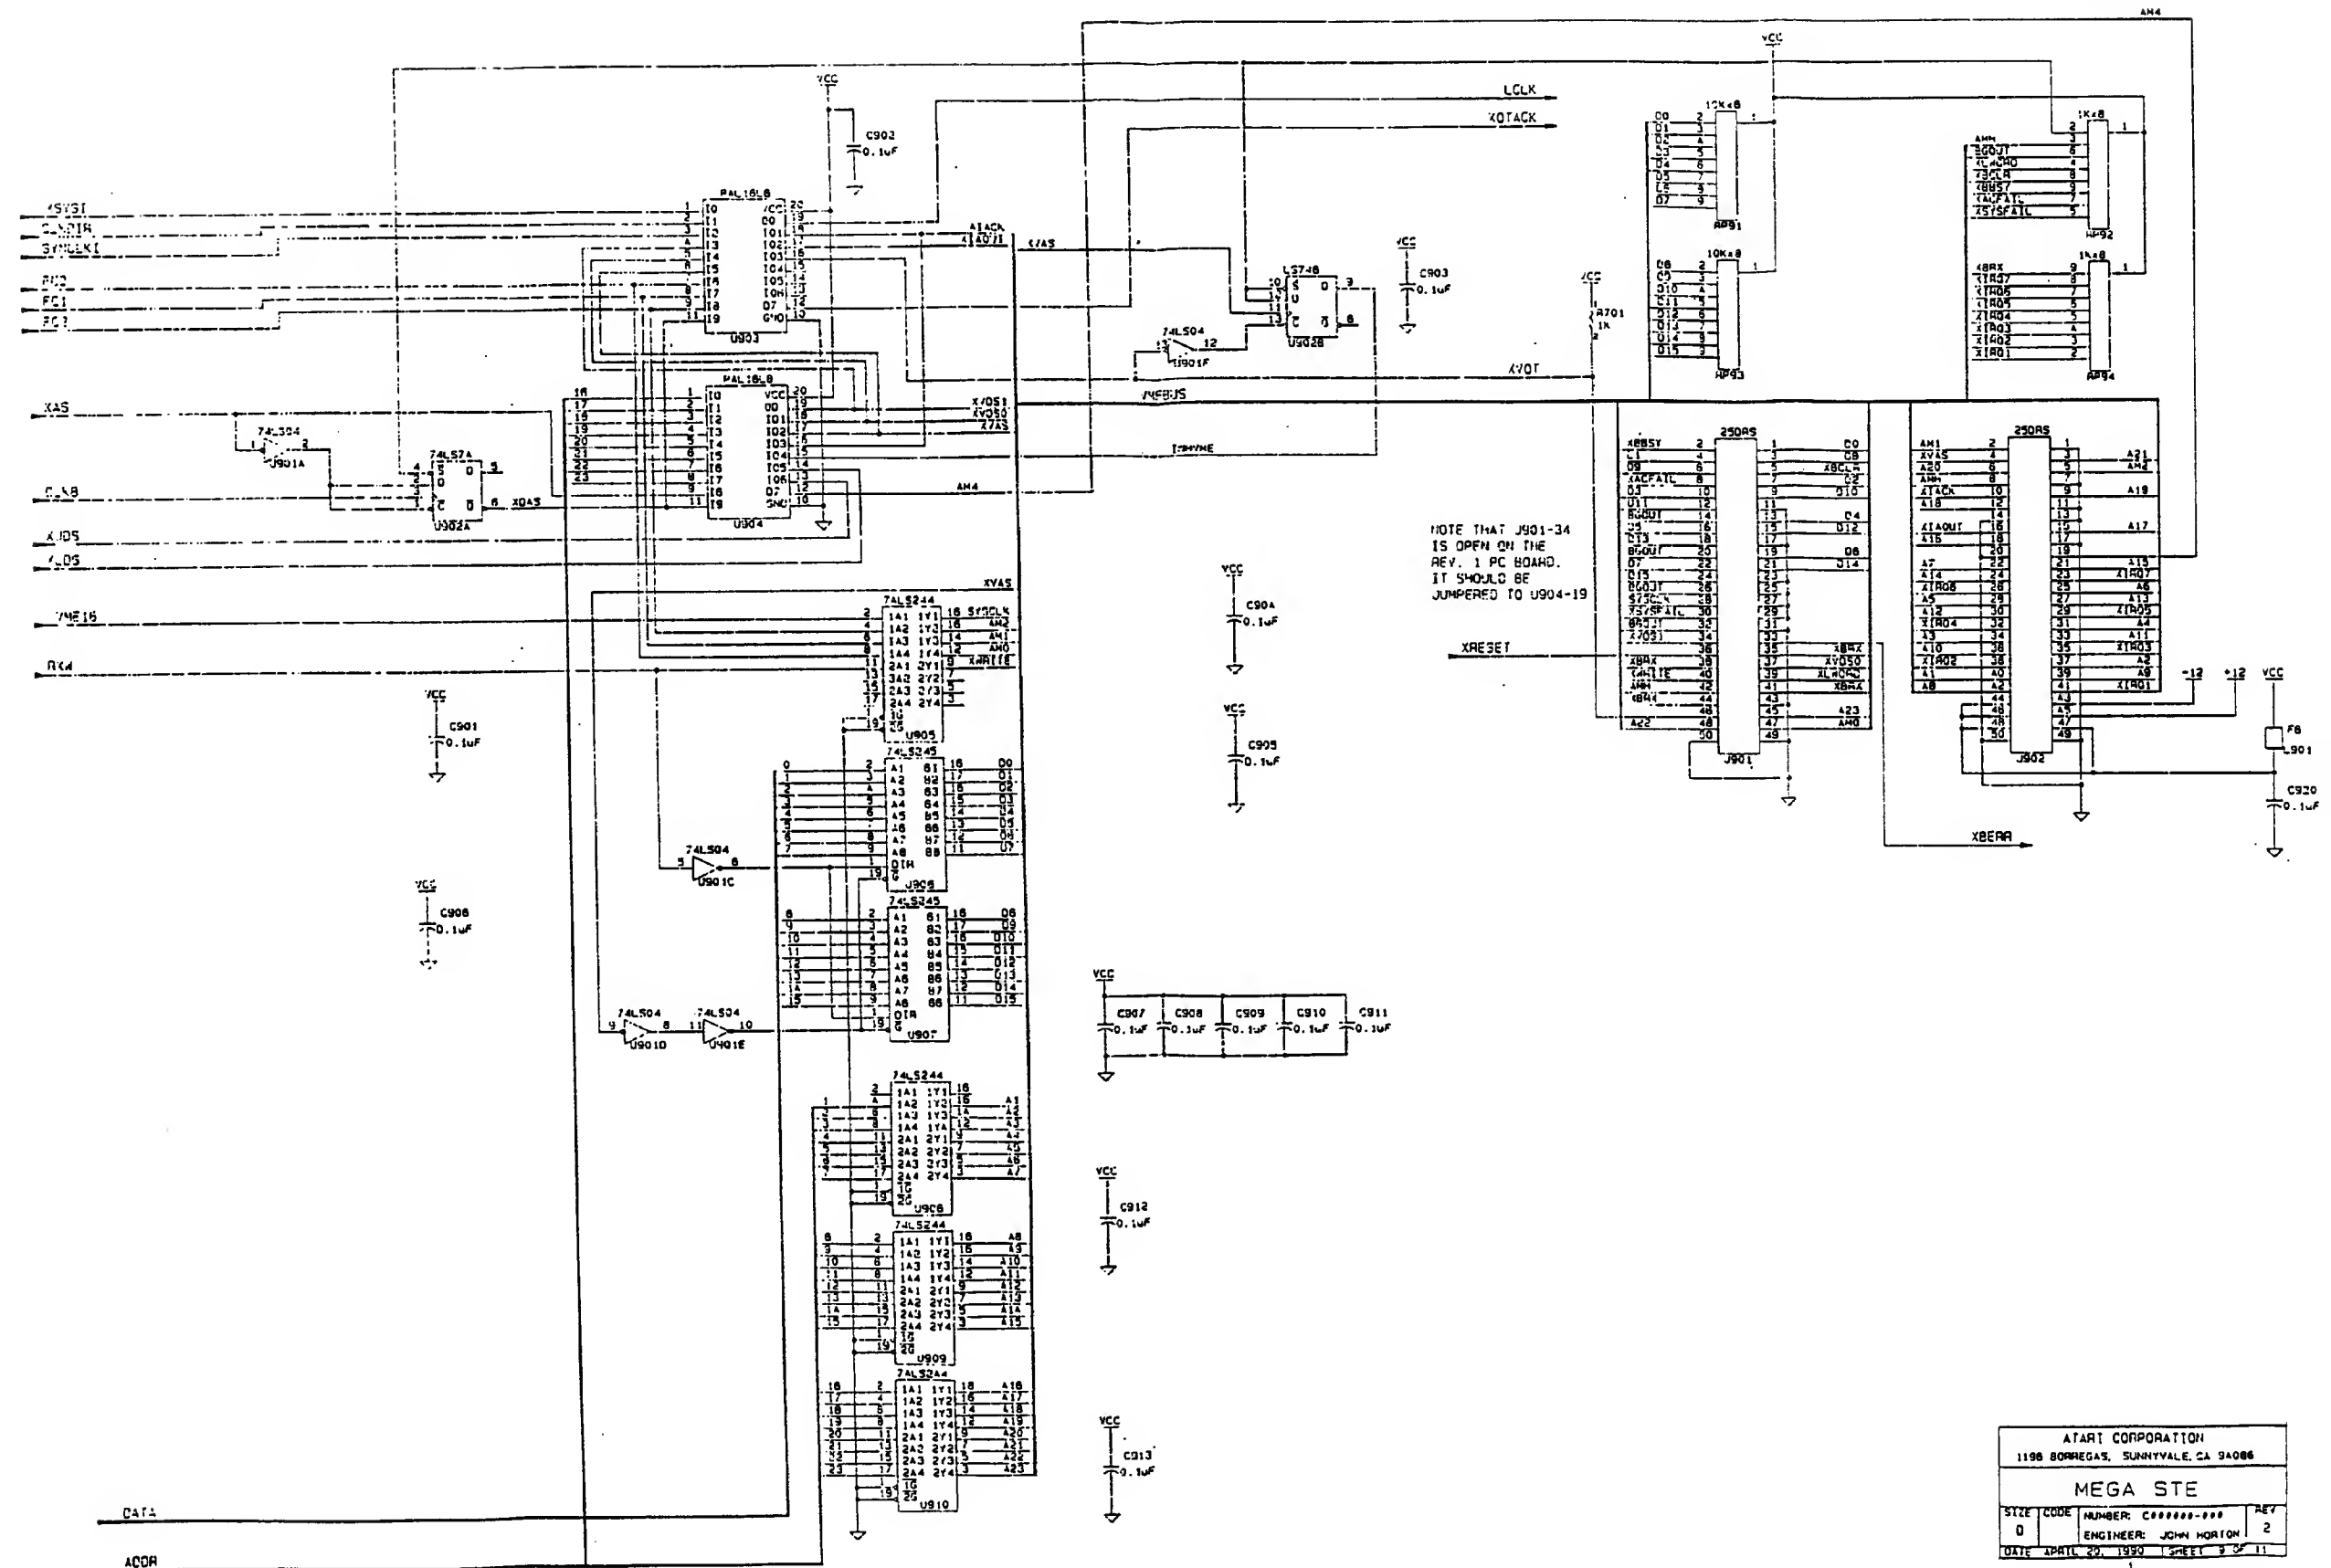

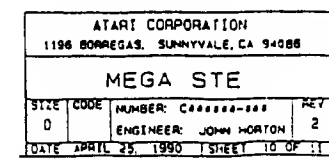

UB01 NEED NOT BE INSTALLED IF UB02 IS NOT PRESENT

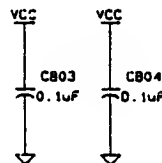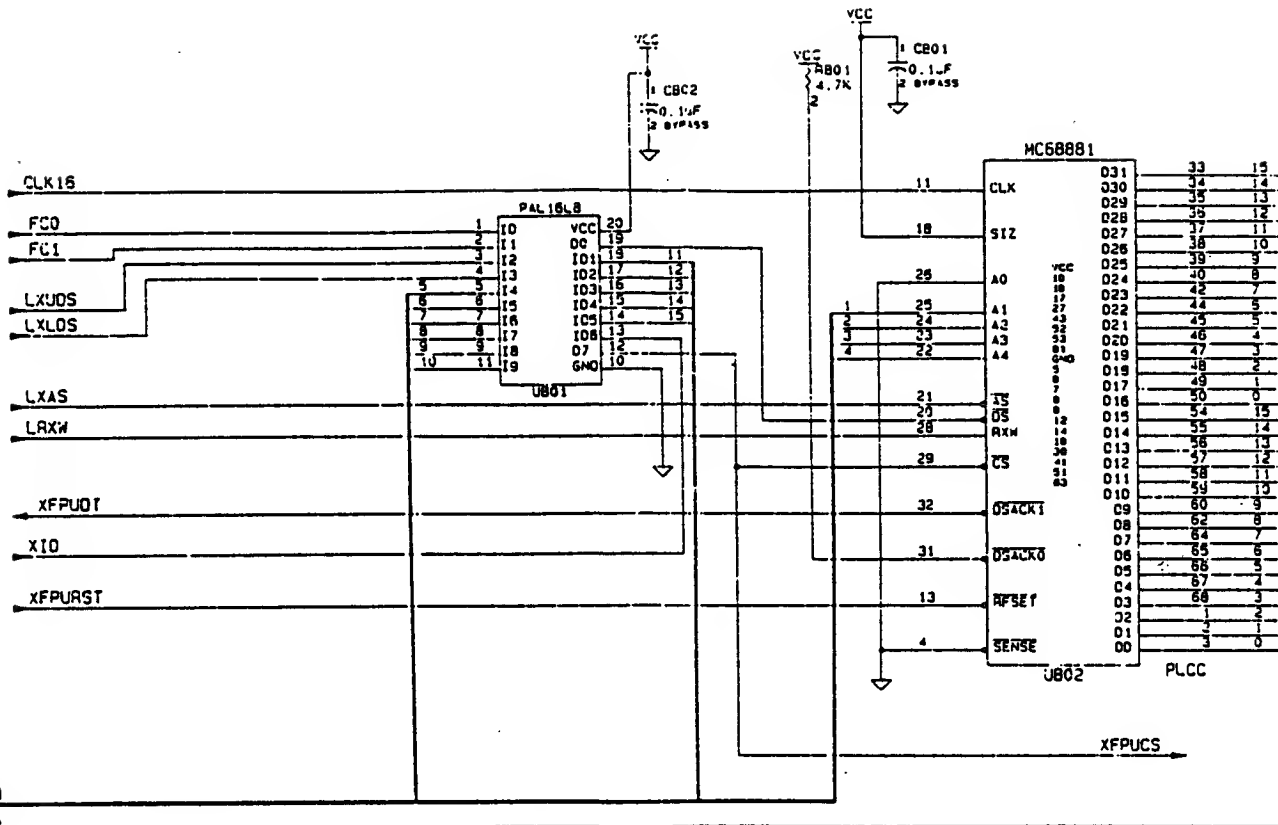

ATARI CORPORATION			
1198 BORREGAS, SUNNYVALE, CA 94086			
MEGA STE			
SIZE	CODE	NUMBER: C80000-000	REV
0		ENGINEER: JOHN MORTON	2
DATE APRIL 20, 1990 SHEET 11 OF 11			